Proper Environment

- Protection class: IP 65 (only with sensor cable connected)

Lenses are excluded from protection class. Contamination of the lenses leads to impairment or failure of the function.

Sensor Mounting

the µm area.

The sensors of the series

carefully!

optoNCDT 1700 are optical sen-

Make sure that mounting

and operation is handled

Mount the sensors with

ing the fastening holes

three screws type M4. The

bearing surfaces surround-

(through holes) are slightly

ε Α Β

26.7° 30.1 22.0

10.9° 32.6 24.1

24 | 35.0 ° | 44.8 ° | 25.8 | 16.8

30 | 34.3 ° | 35.6 ° | 28.7 | 20.5

45 | 26.5 ° | 18.3 ° | 31.5 | 22.5

70 | 19.0 ° | 7.0 ° | 33.1 | 24.1

40 | 28.8 ° | 26.7 ° | 30.1 | 22.0

40 28.8°

19.0°

250VT 70 19.0° 6.0° 33.5 24.1

 
200BL | 100 | 13.5 ° | 6.3 ° | 33.1 | 24.1


100

- Operating temperature: 0 ... 50 °C (+32 up to +122 °F) -20 ... 70 °C (-4 up to +158 °F) Storage temperature: 5 - 95 % (no condensation) Humidity:

- Ambient pressure: Atmospheric pressure

Dimensional Drawing and Free Space, Measuring Ranges 2/10/20/50/100/200/250VT mm Measuring Ranges 20/200BL sors with which is measured in



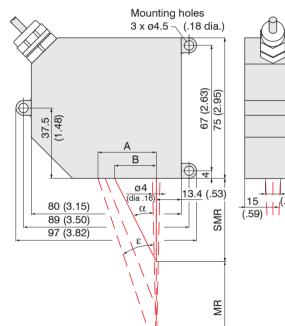


Dimensions in mm (inches), not to scale

MR = Measuring range SMR = Start of measuring range

MMR = Midrange

EMR = End of measuring range

 Membrane Keys, LED's



— O – st

Measurement mode (normal operation):

- Sets the analog output to the value for the midrange, i.e. 5 VDC or
- Pressing the zero key again resets the function.
- function key:
- Switches the sensor to setup mode.

Pressing and holding the function/enter key for longer than 5 seconds, overwrites all the parameter values with the factory settings (default


Setup mode (function key actuated):

- function kev:
- For running through the levels and parameters.
- select key:
- To open the selection list and
- select the value of the parameter in sequence.
- enter kev:
- For saving the selected parameter value and
- returning to measurement mode.

If approximately 15 seconds have elapsed since the last press of the function key or 30 seconds since the last press of the select key, the sensor returns to measurement mode without changing the parameters.

LED	Status	Measurement mode	Setup mode
state	illuminated	Object is in the measurement range or error	
	off	Sensor off or laser off	
	flashes slowly		Selected parameter value matches the saved value
	flashes quickly		Selected parameter value does not match the saved value
output speed	illuminated or flashing	Indication of the parameter values level 1	Selected parameter value
avg	flashing red		Status "off"
zero	illuminated	Sensor "master" or "set to mid-point"	
	off	Normal operation	
	flashing	Sensor as slave without synchronous signal	

In case of bore holes, blind holes and edges in the surface of moving targets the sensor must be arranged in such a way that the edges do not obscure the laser spot.

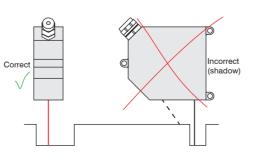

Inputs and Outputs


Pin	Designation	Comment	Sensor cable PC1700-x
5	+U _B	Power supply (11 30 VDC)	red
6	GND	System ground for power supply and switching signals (Laser on/off, Zero, Limits)	black
13	Analog output	Current 4 20 mA or voltage 0 10 V	Coaxial inner conductor, white
14	AGND	Reference potential for analog output	Coaxial screening
9	Laser on/off	Switching input laser on /off	red-blue
10	Zero	Switching input setting mid-point	white-green
8	Switching output 1	Error or limit output	gray-pink
7	Switching output 2	Limit output	violet
3 4	Sync + 1 Sync - 1	Symmetrical synchron output (Master) or input (Slave)	blue pink
1 2	Tx + Tx -	RS422 - output (symmetrical)	green brown
12 11	Rx + Rx - RS422 - input (symmetrical)		gray yellow
Plug	g connector: ODU MII e 0, IP 68; www.odu.c	in mode "Triggering". NI-SNAP, 14-pin, series B, dimension 2, de nale cable connector, insulator	2 (1) (9) (3) (2) (4) (8) (4) (5) (6)

Power Supply, nominal value: 24 VDC (11 ... 30 V, max. 150 mA).

11 30 VDC ILD 1700	Sensor pin	PC1700-x color	Power supply
	5	red	+U _B
<u> </u>	6	black	GND

Use power supply only for measurement devices, MICRO-EPSILON recommends the use of the optional available power supply PS2020 for the sensor.

Switching Inputs Laser On/Off, Setting Masters and Mid-point

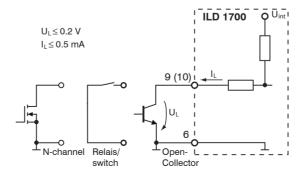

The switching inputs for laser on/off and setting masters/mid-point are similarly wired. Connect pin 9 with pin 6 in order to activate the laser. If the connection is released, the laser is deactivated.

> MICRO-EPSILON MESSTECHNIK GmbH & Co. KG Koenigbacher Str. 15 · 94496 Ortenburg www.micro-epsilon.com







Assembly Instructions optoNCDT 1700

ILD 1700-2/10/20/50/100/200/250VT ILD1700-2/10/20/50LL ILD 1700-20/200BL

Proper Use

The optoNCDT1700 is designed for use in industrial areas. It is used for measuring displacement, distance, position and elongation for in-process quality control and dimensional testing.

The sensor may only be operated within the limits specified in the technical data, see instruction manual, Chap. 3.4. The sensor should only be used in such a way that in case of malfunctions or failure personnel or machinery are not endangered. Additional precautions for safety and damage prevention must be taken for safety-related applications.

Warnings

Connect the power supply in accordance to the safety regulations for electrical equipment. The power supply may not exceed the specified limits.

> Danger of injury, damage to or destruction of the sensor

Avoid continuous exposure to spray on the sensor. Avoid exposure to aggressive materials (washing agent, penetrating liquids or similar) on the sensor. Mount the sensor only to the existing holes on a flat surface. Clamps of any kind are not permitted.

> Damage to or destruction of the sensor

Avoid shock and vibration to the sensor. Protect sensor cable against damage.

> Damage to or destruction of the system, failure of the measuring device

Laser Class

The optoNCDT1700 sensors operate with a semiconductor laser with a wavelength of 670 nm (visible/red, ILD 1700) respectively 405 nm (visible/blue, ILD 1700BL).

The following warning labels are attached to the cover (front and/or rear side) of the sensor housing:



LASER RADIATION

LASER RADIATION Do not stare into the bean CLASS 2 LASER PRODUC IEC 60825-1: 2014 P≤1 mW; λ= 405 nm

IEC label

Only for USA

IEC label for ILD1700-x BL only




Never deliberately look into the laser beam! Consciously close your eyes or turn away immediately if ever the laser beam should hit your eves.




Quick Guide

Components, Typical Application with Analog Output

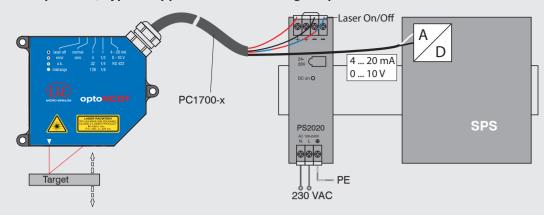

Components, Typical Application with RS422 and IF2008

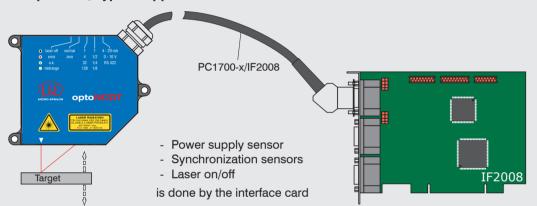

Switching on the Power Supply Respectively PC


Switch on power supply respectively PC after completion of wiring.

The initialization including the info string transmission takes up to 10 seconds. Within this period, the sensor neither executes nor replies commands.

To be able to produce reproducible measurements the sensor typically requires a start-up time of 20 minutes.


Change Measurement Value Output

Change the output type with the function/enter and select/zero keys.

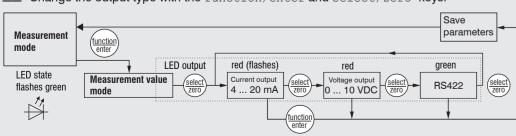

Place Target

Place the target in the midrange, if possible.

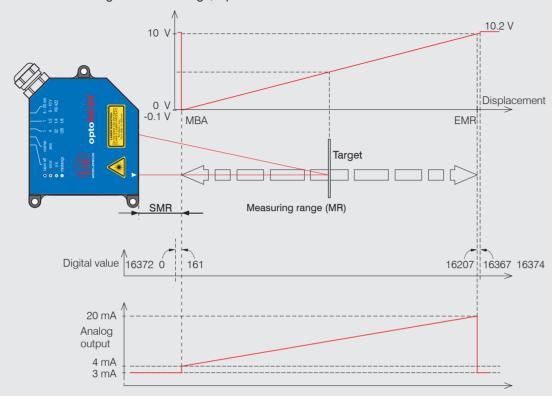

The State LED on sensor indicates the position of target to the sensor.

LED	Color		Meaning
State	0	off	Laser beam is switched off.
	->-	green	Sensor in operation, target in measuring range
	->-	yellow	Target is in midrange.
	->	red	Target out of range, too low reflection

Operating Mode

Change the operating mode of the sensor.

Error-Mode (error control, factory setting)


Switching output 1 Switching output 2	↑ Measurement value
Error output inactive	EMR
The switching output 1 is activated (conducting to GND), - when the target is outside the measuring range, - there is no target present - or if the target is unsuitable (too dark, polished metal, insufficiently reflective).	SMR
Function - Setting mid-point - No limit control	Switching output 1 Switching output 2 GND Switching output 2

Switch-Mode (limit control)

Switching output 1	Switching output 2	EMR
Limit value	Limit value	ŪĽ
The switching outputs are activated (conducting to GND), - when the target is outside the measuring range, - there is no target present - or if a target is unsuitable (too dark, polished metal, insufficiently reflective). The following 4 values are used: - Upper limit (UL), - Lower limit (LL), - Upper hysteresis value (UH), - Lower hysteresis value (LH).		LH LL SMR Time
		+ Switching output 1 GND + Switching output 2 GND SET_UPPERLIMIT F1 + Switching output 1
Function - Mastering - Limit control		GND Switching output 2 GND SET_LOWERLIMIT F1

Please refer to the instruction manual for factory settings to the limit and hysteresis values.

Switching Outputs

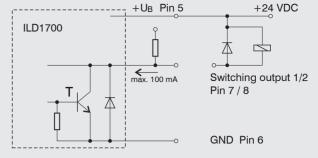

The transistor T is conductive in the active state. The switching outputs are short-circuit-proof.

To reset the short-circuit protection:

- Clear the external short circuit.
- switch off the sensor and switch on again or
- send the software command "Reset" to the sensor.

The two limit outputs may also be actuated in parallel as window comparator (OK/Not OK separation).

You will find informations on display and signal processing units online at: www.micro-epsilon.com/accessories/index.html.

You can read more information about the sensor in the instruction manual. You will find these online at www.micro-epsilon.de/download/manuals/man--optoNCDT-1700--en.pdf or on the delivered CD.